

**Flood Control Project Maintenance
Levee Inspections
LMA District Cover Sheet
Spring 2010 Levee Inspection Results**

Reclamation District No. 2058 Pescadero

	Spring (March - May)	Summer ** (June - August)	Fall (September - November)	Winter ** (December - February)
* Overall LMA Rating (Fall Only)				

** Non-receipt of Summer or Winter Inspection Reports may effect overall annual rating.

*

SPRING INSPECTIONS: Overall maintenance ratings are not determined for the spring inspection results. Individual maintenance deficiencies are rated using the same criteria in the spring and in the fall.

FALL INSPECTIONS: The overall maintenance rating shown above is based on operation and maintenance deficiencies identified within the attached unit inspection reports.

Comments

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2010 Levee Inspection Results

Reclamation District No. 2058 Pescadero

Waterway			Bank	Unit Miles
Unit No. 01 Paradise Cut			Left	6.71

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	5/26/2010 - 5/26/2010			
DWR Inspector	John Paasch			
Accompanied By	Greg Pombo RD 2058			
	Brian Hansen FWS			

Check one:

- ☐ During the current winter (or summer) inspection period, my staff or I have inspected the levee and associated flood project components identified in the attached Levee Inspection Report by Mile. We have found no changes in flood project conditions other than the results of our normal maintenance and the corrections we have made to maintenance deficiencies identified in the enclosed report.
- ☐ During the current winter (or summer) inspection period, my staff or I have inspected the levee and associated flood project components identified in the attached Levee Inspection Report by Mile. In addition to the results of our normal maintenance and the corrections we have made to maintenance deficiencies identified in the report, we have found the following changes in flood project conditions.

(In the comment section below or on additional sheet(s), identify change of condition by: Start to End Levee Mile or GPS coordinates, location (Land Side, Water Side, or Crown), Item identification, and description of the current condition).

Comments

One of the boxes above is to be checked by the Local Maintaining Agency (LMA). If the second box is checked, additional information must also be submitted. This Unit Cover Sheet should be signed and dated by the LMA Representative and returned to DWR with any additional sheets by September 30 (Summer Inspection) or March 31 (Winter Inspection). Please retain a copy for your records. Please mail all of this information to :

DWR Summer/Winter Inspection Reports
3310 El Camino Avenue, Room LL-30
Sacramento, CA 95821-9000

X

Signature of LMA Representative

Date

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Reclamation District No. 2058 Pescadero

Waterway				Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut				Left	6.71	05/26/2010 05/26/2010	John Paasch

LMR No	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
1	0.03	0.03	Earthen Levee	Encroachments	LS	M	Material Inspector Comments: Poles and concrete on slope.	37.801967 ° -121.420512 °	37.801967 ° -121.420512 °	3 Y
2	0.05	0.05	Earthen Levee	Encroachments	WS	M	Debris Inspector Comments: Rusted metal pipe and concrete is present within 20-ft of crown.	37.802209 ° -121.420356 °	37.802209 ° -121.420356 °	946
3	0.12	0.12	Earthen Levee	Animal Control	WS	M	No rodents visible, but rodent burrows visible; need to backfill and compact or grout borrows. Inspector Comments: Burrow holes on water side of crown. Levee crown is abnormally wide at this point.	37.803012 ° -121.419732 °	37.803012 ° -121.419732 °	947
4	0.14	0.14	Earthen Levee	Animal Control	LS	M	Exterminate rodents and backfill and compact or grout burrows.	37.803316 ° -121.419494 °	37.803316 ° -121.419494 °	7 Y
5	0.15	0.18	Earthen Levee	Encroachments	WS	C	Prunings Inspector Comments: Prunings piled on water side hinge point are obstructive.	37.803416 ° -121.419411 °	37.803876 ° -121.419042 °	948
6	0.18	0.29	Earthen Levee	Vegetation	LS	M	Control annual grass and weeds on the levee slopes and easements. Inspector Comments: Removal of this type of vegetation is currently prohibited by FWS due to concerns with RBR.	37.803786 ° -121.419120 °	37.804719 ° -121.417548 °	8 Y
7	0.19	0.21	Earthen Levee	Trim / Thin Trees	WS	C	Trim trees to at least five feet above ground level.	37.803853 ° -121.419083 °	37.804025 ° -121.418712 °	4
8	0.19	0.19	Earthen Levee	Animal Control	WS	M	Exterminate rodents and backfill and compact or grout burrows.	37.803951 ° -121.418961 °	37.803951 ° -121.418961 °	10
9	0.21	0.21	Earthen Levee	Encroachments	WS	M	Prunings	37.804084 ° -121.418827 °	37.804084 ° -121.418827 °	12
10	0.27	0.29	Earthen Levee	Trim / Thin Trees	WS	C	Trim trees to at least five feet above ground level.	37.804553 ° -121.417967 °	37.804657 ° -121.417567 °	936
11	0.28	0.28	Earthen Levee	Animal Control	CR	M	No rodents visible, but rodent burrows visible; need to backfill and compact or grout borrows. Inspector Comments: multiple holes	37.804706 ° -121.417754 °	37.804706 ° -121.417754 °	18
12	0.29	0.34	Earthen Levee	Animal Control	WS	M	Exterminate rodents and backfill and compact or grout burrows.	37.804719 ° -121.417548 °	37.804430 ° -121.416532 °	944
13	0.34	3.11	Earthen Levee	Vegetation	WS	M	Control annual grass and weeds on the levee slopes and easements. Inspector Comments: If condition persists rating in Fall will be U. District has begun a grazing program to manage the vegetation.	37.804373 ° -121.416872 °	37.799686 ° -121.369776 °	19 Y

*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected
C : Corrected
W : Watch/Monitor

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Reclamation District No. 2058 Pescadero

Waterway						Bank	Unit Miles	Inspection Start/End	Inspector	
Unit No. 01 Paradise Cut						Left	6.71	05/26/2010 05/26/2010	John Paasch	
LMR No	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
14	0.35	3.11	Earthen Levee	Vegetation	LS	M	Control annual grass and weeds on the levee slopes and easements. Inspector Comments: If condition persists rating in Fall will be U. District has begun a grazing program to manage the vegetation.	37.804207 ° -121.416628 °	37.799686 ° -121.369777 °	20 Y
15	0.41	0.43	Earthen Levee	Vegetation	WS	M	Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Brush within 20-ft of levee crown impedes access and visibility. Removal of this type of vegetation is currently prohibited by FWS due to concerns with RBR.	37.803831 ° -121.415718 °	37.803668 ° -121.415530 °	949
16	0.44	0.44	Earthen Levee	Vegetation	LS	M	Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Brush within 10-ft of landside toe limits access and visibility.	37.803598 ° -121.415465 °	37.803598 ° -121.415465 °	950
17	0.50	0.71	Earthen Levee	Vegetation	CR	M	Control annual grass and weeds on the levee slopes and easements. Inspector Comments: If condition persists rating in Fall will be U. District has begun a grazing program to manage the vegetation.	37.802834 ° -121.414550 °	37.801834 ° -121.411244 °	953
18	0.50	0.71	Earthen Levee	Vegetation	LS	C	Control annual grass and weeds on the levee slopes and easements. Inspector Comments: Issue contained in previous item mileage.	37.802903 ° -121.414648 °	37.801834 ° -121.411244 °	952
19	0.64	0.71	Earthen Levee	Trim / Thin Trees	WS	C	Trim trees to at least five feet above ground level.	37.801942 ° -121.412543 °	37.801835 ° -121.411244 °	954
20	0.77	1.03	Earthen Levee	Vegetation	LS	M	Control annual grass and weeds on the levee slopes and easements. Inspector Comments: Vegetaion within 10-ft of levee toe blocks visibility.	37.801752 ° -121.410145 °	37.801394 ° -121.405569 °	955
21	0.77	0.83	Earthen Levee	Vegetation	WS	C	Control annual grass and weeds on the levee slopes and easements. Inspector Comments: Issue contained in previous item.	37.801749 ° -121.410127 °	37.801627 ° -121.409150 °	956
22	0.79	3.11	Earthen Levee	Vegetation	CR	M	Control annual grass and weeds on the levee slopes and easements. Inspector Comments: If condition persists rating in Fall will be U. District has begun a grazing program to manage the vegetation.	37.801717 ° -121.409780 °	37.799686 ° -121.369774 °	21 Y
23	0.82	0.93	Earthen Levee	Trim / Thin Trees	WS	U	Trim and thin trees to allow visibility of the ground and room to flood fight.	37.801687 ° -121.409448 °	37.801436 ° -121.407456 °	14 Y
24	0.83	0.83	Earthen Levee	Trim / Thin Trees	LS	C	Trim trees to at least five feet above ground level.	37.801618 ° -121.409200 °	37.801618 ° -121.409200 °	937

*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected
C : Corrected
W : Watch/Monitor

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Reclamation District No. 2058 Pescadero

Waterway				Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut				Left	6.71	05/26/2010 05/26/2010	John Paasch

LMR No	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
25	0.97	1.05	Earthen Levee	Trim / Thin Trees	WS	M	Trim trees to at least five feet above ground level.	37.801378 ° -121.406636 °	37.801442 ° -121.405179 °	957
26	1.12	1.17	Earthen Levee	Trim / Thin Trees	WS	M	Trim trees to at least five feet above ground level.	37.801687 ° -121.404178 °	37.801900 ° -121.403308 °	5
27	1.22	1.22	Earthen Levee	Vegetation	WS	U	Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Removal of this type of vegetation is currently prohibited by FWS due to concerns with RBR.	37.802253 ° -121.402242 °	37.802253 ° -121.402242 °	958 Y
28	1.24	1.24	Earthen Levee	Encroachments	CR	W	Pipe	37.802314 ° -121.401984 °	37.802314 ° -121.401984 °	22 Y
29	1.29	1.33	Earthen Levee	Vegetation	WS	M	Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Removal of this type of vegetation is currently prohibited by FWS due to concerns with RBR.	37.802495 ° -121.401157 °	37.802652 ° -121.400542 °	6
30	1.30	1.30	Earthen Levee	Vegetation	WS	U	Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Removal of his type of vegetation has been prohibited due to FWS concerns with RBR.	37.802581 ° -121.400861 °	37.802581 ° -121.400861 °	15 Y
31	1.34	1.34	Earthen Levee	Vegetation	WS	U	Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Removal of this type of vegetation is currently prohibited by FWS due to concerns with RBR.	37.802743 ° -121.400188 °	37.802743 ° -121.400188 °	959 Y
32	1.35	1.38	Earthen Levee	Vegetation	WS	M	Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Removal of this type of vegetation is currently prohibited by FWS due to concerns with RBR.	37.802737 ° -121.400201 °	37.802886 ° -121.399551 °	16
33	1.49	1.52	Earthen Levee	Vegetation	WS	C	Control annual grass and weeds on the levee slopes and easements. Inspector Comments: Included in previous issue item.	37.803363 ° -121.397543 °	37.803469 ° -121.397107 °	960
34	1.69	1.72	Earthen Levee	Vegetation	WS	M	Elderberries are blocking visibility and flood fight capability. Inspector Comments: Removal of this type of vegetation is currently prohibited by FWS.	37.804158 ° -121.394169 °	37.804329 ° -121.393612 °	961
35	1.72	1.74	Earthen Levee	Vegetation	WS	M	Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Removal of this type of vegetation is currently prohibited by FWS due to concerns with RBR.	37.804340 ° -121.393570 °	37.804431 ° -121.393256 °	962
36	1.80	1.84	Earthen Levee	Trim / Thin Trees	WS	M	Trim and thin trees to allow visibility of the ground and room to flood fight.	37.804658 ° -121.392300 °	37.804795 ° -121.391521 °	17
37	1.89	1.92	Earthen Levee	Trim / Thin Trees	WS	U	Thin trees to allow visibility of the ground and room to flood fight.	37.804783 ° -121.390579 °	37.804720 ° -121.390123 °	963 Y

*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected
C : Corrected
W : Watch/Monitor

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Reclamation District No. 2058 Pescadero

Waterway				Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut				Left	6.71	05/26/2010 05/26/2010	John Paasch

LMR No	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No.
	Start	End						Start	End	
38	1.99	2.03	Earthen Levee	Trim / Thin Trees	WS	M	Thin trees to allow visibility of the ground and room to flood fight.	37.804497 ° -121.388905 °	37.804350 ° -121.388252 °	964
39	2.15	2.15	Supplemental	DWR Erosion Survey	WS	M	Inspector Comments: 2009: A possible leak or spill from a siphon breaker is eroding the slope and developing into a headward erosion; a portion of the buried pipe is exposed; the lower slope seems to be lined with chunks of concrete debris or other rock material [2009 SiteID:RD2058U1RM1.78]	37.803769 ° -121.386341 °	37.803769 ° -121.386341 °	1 Y
40	2.15	2.15	Earthen Levee	Encroachments	CR	W	Pipe	37.803910 ° -121.386295 °	37.803910 ° -121.386295 °	23 Y
41	2.42	2.42	Earthen Levee	Trim / Thin Trees	WS	M	Thin trees to allow visibility of the ground and room to flood fight.	37.802793 ° -121.381354 °	37.802793 ° -121.381354 °	965
42	2.45	2.45	Earthen Levee	Encroachments	LS	C	Prunings Inspector Comments: Tumble weeds piled on landside slope.	37.802683 ° -121.380943 °	37.802683 ° -121.380943 °	966
43	2.73	2.73	Earthen Levee	Encroachments	LS	C	Prunings Inspector Comments: Tumble weeds on slope.	37.801581 ° -121.376026 °	37.801581 ° -121.376026 °	968
44	2.80	2.80	Earthen Levee	Vegetation	WS	M	Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Removal of this type of vegetation is currently prohibited by FWS due to concerns with RBR.	37.801329 ° -121.374926 °	37.801329 ° -121.374926 °	969
45	2.89	2.89	Earthen Levee	Encroachments	WS	W	Pipe	37.800894 ° -121.373135 °	37.800894 ° -121.373135 °	24 Y
46	2.92	2.96	Earthen Levee	Vegetation	WS	M	Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Removal of this type of vegetation is currently prohibited by FWS due to concerns with RBR.	37.800805 ° -121.372815 °	37.800641 ° -121.372152 °	970
47	3.12	5.98	Earthen Levee	Vegetation	WS	M	Control annual grass and weeds on the levee slopes and easements. Inspector Comments: If condition persists rating in Fall will be U. District has begun a grazing program to manage the vegetation.	37.799522 ° -121.369445 °	37.775877 ° -121.336137 °	25 Y
48	3.19	3.19	Earthen Levee	Trim / Thin Trees	WS	M	Trim trees to at least five feet above ground level.	37.798877 ° -121.368653 °	37.798877 ° -121.368653 °	938
49	3.28	3.40	Earthen Levee	Vegetation	WS	C	Control annual grass and weeds on the levee slopes and easements. Inspector Comments: Included in previous issue item.	37.798020 ° -121.367605 °	37.796495 ° -121.366342 °	971
50	3.41	3.41	Earthen Levee	Encroachments	CR	W	Pipe Inspector Comments: discharge	37.796421 ° -121.366254 °	37.796421 ° -121.366254 °	27

*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected
C : Corrected
W : Watch/Monitor

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Reclamation District No. 2058 Pescadero

Waterway						Bank	Unit Miles	Inspection Start/End	Inspector	
Unit No. 01 Paradise Cut						Left	6.71	05/26/2010 05/26/2010	John Paasch	
LMR No.	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
51	3.55	5.58	Earthen Levee	Vegetation	LS	M	Control annual grass and weeds on the levee slopes and easements.	37.794661 ° -121.365108 °	37.780400 ° -121.340038 °	26
52	3.67	3.74	Earthen Levee	Vegetation	WS	C	Control annual grass and weeds on the levee slopes and easements.	37.793127 ° -121.364236 °	37.792214 ° -121.363698 °	973
53	3.76	3.76	Earthen Levee	Vegetation	WS	M	Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Flagged bushes obstructing visibility and access	37.791856 ° -121.363514 °	37.791856 ° -121.363514 °	974
54	3.77	3.77	Earthen Levee	Vegetation	WS	U	Elderberries are blocking visibility and flood fight capability. Inspector Comments: Removal of this type of vegetation is currently prohibited by FWS.	37.791745 ° -121.363553 °	37.791745 ° -121.363553 °	939 Y
55	3.96	3.96	Earthen Levee	Trim / Thin Trees	LS	M	Trim trees to at least five feet above ground level. Inspector Comments: Condition of trees has not changed.	37.789398 ° -121.361713 °	37.789398 ° -121.361713 °	975 Y
56	3.97	4.03	Earthen Levee	Encroachments	LS	PO	Fences Inspector Comments: Mangled barbed wire fence on levee slope	37.789369 ° -121.361644 °	37.789005 ° -121.360694 °	976
57	4.01	4.01	Earthen Levee	Trim / Thin Trees	LS	M	Trim trees over roadway to at least 12 feet above ground level.	37.789105 ° -121.360988 °	37.789105 ° -121.360988 °	28
58	4.09	4.09	Earthen Levee	Encroachments	CR	M	Tree or limb Inspector Comments: Fallen tree on levee slope and crown limits access.	37.788813 ° -121.359523 °	37.788813 ° -121.359523 °	29
59	4.10	4.10	Earthen Levee	Trim / Thin Trees	LS	M	Trim trees to at least five feet above ground level.	37.788730 ° -121.359537 °	37.788730 ° -121.359537 °	9
60	4.10	4.10	Earthen Levee	Encroachments	LS	M	Debris Inspector Comments: Straw, plastic and cuttings on levee slope and crown.	37.788803 ° -121.359316 °	37.788803 ° -121.359316 °	977
61	4.49	4.53	Supplemental	DWR Erosion Survey	WS	M	Inspector Comments: 2009: No major change observed; site is a 200 ft long near-vertical berm erosion; recommend annual assessment and monitoring of erosion site, per CLRO CES Evaluation 2008 Report; site # is same as RM4.0,LM4.51; previously rated "U" [2009 SiteID:RD2058U1RM3.97]	37.789810 ° -121.352490 °	37.789810 ° -121.352490 °	2 Y
62	4.58	4.58	Earthen Levee	Animal Control	WS	C	Exterminate rodents and backfill and compact or grout burrows.	37.789263 ° -121.351352 °	37.789263 ° -121.351352 °	978
63	4.81	4.81	Earthen Levee	Trim / Thin Trees	WS	M	Trim trees to at least five feet above ground level.	37.786005 ° -121.350508 °	37.786005 ° -121.350508 °	941
64	4.83	4.83	Earthen Levee	Animal Control	LS	C	Exterminate rodents and backfill and compact or grout burrows.	37.785810 ° -121.350279 °	37.785810 ° -121.350279 °	979

*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected
C : Corrected
W : Watch/Monitor

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Reclamation District No. 2058 Pescadero

Waterway							Bank	Unit Miles	Inspection Start/End	Inspector	
Unit No. 01 Paradise Cut							Left	6.71	05/26/2010 05/26/2010	John Paasch	
LMR No.	Levee Mile		Category	Item	* Location	* Rating	Action/Comment	GPS Latitude/Longitude		Issue No.	
	Start	End						Start	End	Photo	
65	4.87	4.87	Earthen Levee	Trim / Thin Trees	WS	M	Trim trees to at least five feet above ground level.	37.785190 ° -121.350078 °	37.785190 ° -121.350078 °	11	
66	4.97	4.97	Earthen Levee	Animal Control	WS	C	Exterminate rodents and backfill and compact or grout burrows.	37.784382 ° -121.348614 °	37.784382 ° -121.348614 °	980	
67	5.11	5.15	Earthen Levee	Encroachments	WS	C	Prunings	37.783405 ° -121.346608 °	37.783094 ° -121.345797 °	981	
68	5.37	5.37	Earthen Levee	Encroachments	WS	C	Garbage	37.782340 ° -121.342170 °	37.782340 ° -121.342170 °	982	
69	5.62	5.73	Earthen Levee	Encroachments	WS	C	Prunings	37.779675 ° -121.339906 °	37.778479 ° -121.339106 °	983	
70	6.01	6.57	Earthen Levee	Vegetation	LS	A	Control annual grass and weeds on the levee slopes and easements. Inspector Comments: Levee free of obstructive vegetation.	37.775558 ° -121.335838 °	37.770145 ° -121.329648 °	32 Y	
71	6.01	6.01	Earthen Levee	Encroachments	WS	M	Garbage Inspector Comments: No change since last inspection.	37.775558 ° -121.335830 °	37.775558 ° -121.335830 °	13	
72	6.42	6.42	Earthen Levee	Animal Control	LS	M	No rodents visible, but rodent burrows visible; need to backfill and compact or grout borrows. Inspector Comments: Numerous burrows remain on levee.	37.772047 ° -121.330188 °	37.772047 ° -121.330188 °	985	

*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected
C : Corrected
W : Watch/Monitor

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.71	05/26/2010 05/26/2010	John Paasch

Levee Mile Report Line	1
Start Levee Mile	0.03
End Levee Mile	0.03
Location	Land Side
Category	Earthen Levee
Item	Encroachments

Wood poles, railroad ties and other debris on landside slope should be removed though they appear to prevent access to cart path.

jpaasch_s_20100528_459.jpg



Levee Mile Report Line	4
Start Levee Mile	0.14
End Levee Mile	0.14
Location	Land Side
Category	Earthen Levee
Item	Animal Control

Active animal burrows on landside slope.

jpaasch_s_20100528_460.jpg



Levee Mile Report Line	6
Start Levee Mile	0.18
End Levee Mile	0.29
Location	Land Side
Category	Earthen Levee
Item	Vegetation

Vegetation on landside slope and toe. Dense brush

jpaasch_s_20100528_461.jpg



*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected
C : Corrected
W : Watch/Monitor

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.71	05/26/2010 05/26/2010	John Paasch

Levee Mile Report Line	13
Start Levee Mile	0.34
End Levee Mile	3.11
Location	Water Side
Category	Earthen Levee
Item	Vegetation
Obstructive Mustard Weed on levee crown and top 20' of waterside slope. Photo taken from Paradise Ave bridge.	
jpaasch_s_20100528_455.jpg	



Levee Mile Report Line	14
Start Levee Mile	0.35
End Levee Mile	3.11
Location	Land Side
Category	Earthen Levee
Item	Vegetation
Mustard weed obstructs access and visibility to landside slope and toe.	
jpaasch_s_20100528_456.jpg	



Levee Mile Report Line	22
Start Levee Mile	0.79
End Levee Mile	3.11
Location	Crown
Category	Earthen Levee
Item	Vegetation
Mustard weed on levee crown obstructs visibility and access.	
jpaasch_s_20100528_462.jpg	

*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable PO : Partially Obstructing C : Corrected
M : Minimally Acceptable CO : Completely Obstructing W : Watch/Monitor
U : Unacceptable N : Not Inspected

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.71	05/26/2010 05/26/2010	John Paasch

Levee Mile Report Line	23
Start Levee Mile	0.82
End Levee Mile	0.93
Location	Water Side
Category	Earthen Levee
Item	Trim / Thin Trees

Dense trees on waterside slope obstruct access and visibility.

jhirabay_s_20100614_467.jpg



Levee Mile Report Line	27
Start Levee Mile	1.22
End Levee Mile	1.22
Location	Water Side
Category	Earthen Levee
Item	Vegetation

Dense brush on top 20' of waterside slope obstructs access and visibility.

jhirabay_s_20100614_468.jpg



Levee Mile Report Line	28
Start Levee Mile	1.24
End Levee Mile	1.24
Location	Crown
Category	Earthen Levee
Item	Encroachments

Drainage discharge to Paradise Cut.

jpaasch_s_20100528_463.jpg



*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected
C : Corrected
W : Watch/Monitor

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.71	05/26/2010 05/26/2010	John Paasch

Levee Mile Report Line	30
Start Levee Mile	1.30
End Levee Mile	1.30
Location	Water Side
Category	Earthen Levee
Item	Vegetation

Tall brush on top 20' of waterside slope obstructs access and visibility.

jhirabay_s_20100614_469.jpg



Levee Mile Report Line	31
Start Levee Mile	1.34
End Levee Mile	1.34
Location	Water Side
Category	Earthen Levee
Item	Vegetation

Tall brush on top 20' of waterside slope obstructs access and visibility.

jhirabay_s_20100614_470.jpg



Levee Mile Report Line	37
Start Levee Mile	1.89
End Levee Mile	1.92
Location	Water Side
Category	Earthen Levee
Item	Trim / Thin Trees

Dense trees on top 20' of waterside slope obstructs access and visibility.

jhirabay_s_20100614_471.jpg



*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected
C : Corrected
W : Watch/Monitor

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.71	05/26/2010 05/26/2010	John Paasch

Levee Mile Report Line	39
Start Levee Mile	2.15
End Levee Mile	2.15
Location	Water Side
Category	Supplemental
Item	DWR Erosion Survey

2009: A possible leak or spill from a siphon breaker is eroding the slope and developing into a headward erosion; a portion of the buried pipe is exposed; the lower slope seems to be lined with chunks of concrete debris or other rock material [2009 SiteID:RD2058U1RM1.78]

SJR2009_RM1.78U1_072309e.jpg



Levee Mile Report Line	40
Start Levee Mile	2.15
End Levee Mile	2.15
Location	Crown
Category	Earthen Levee
Item	Encroachments

Drainage discharge to Paradise Cut.

jpaasch_s_20100528_464.jpg



Levee Mile Report Line	45
Start Levee Mile	2.89
End Levee Mile	2.89
Location	Water Side
Category	Earthen Levee
Item	Encroachments

Irrigation intake from Paradise Cut.

jpaasch_s_20100528_465.jpg



*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected
C : Corrected
W : Watch/Monitor

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.71	05/26/2010 05/26/2010	John Paasch

Levee Mile Report Line	47
Start Levee Mile	3.12
End Levee Mile	5.98
Location	Water Side
Category	Earthen Levee
Item	Vegetation
Mustard weed on waterside slope and crown obstructs access and visibility.	
jpaasch_s_20100528_466.jpg	



Levee Mile Report Line	54
Start Levee Mile	3.77
End Levee Mile	3.77
Location	Water Side
Category	Earthen Levee
Item	Vegetation
Tall brush on top 20' of waterside slope obstructs access and visibility.	
jhirabay_s_20100614_472.jpg	



Levee Mile Report Line	55
Start Levee Mile	3.96
End Levee Mile	3.96
Location	Land Side
Category	Earthen Levee
Item	Trim / Thin Trees
Fall 2009 photo of trees needing trimming to allow access and visibility.	
jpaasch_s_20100330_154.jpg	

*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected
C : Corrected
W : Watch/Monitor

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.71	05/26/2010 05/26/2010	John Paasch

Levee Mile Report Line	61
Start Levee Mile	4.49
End Levee Mile	4.53
Location	Water Side
Category	Supplemental
Item	DWR Erosion Survey

2009: No major change observed; site is a 200 ft long near-vertical berm erosion; recommend annual assessment and monitoring of erosion site, per CLRO CES Evaluation 2008 Report; site # is same as RM4.0,LM4.51; previously rated "U" [2009 SiteID:RD2058U1RM3.97]

SJR2009_RM3.97U1_072309e.jpg



Levee Mile Report Line	70
Start Levee Mile	6.01
End Levee Mile	6.57
Location	Land Side
Category	Earthen Levee
Item	Vegetation

Levee free of obstructive vegetation.

jpaasch_s_20100528_454.jpg



*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable PO : Partially Obstructing C : Corrected
M : Minimally Acceptable CO : Completely Obstructing W : Watch/Monitor
U : Unacceptable N : Not Inspected